



the **play inspection** company

Annual Inspection

Mid Suffolk District Council

Buxhall

Off Mill Road, Suffolk, IP14 3DS



API Associate



Unit 5, Glenmore Business Park, Blackhill Road, Poole, Dorset, BH16 6NL
t- 01202 590675 e- info@playinspections.co.uk

[www. playinspections .co.uk](http://www.playinspections.co.uk)

Inspection Scope for RPII Inspection Methodology

This document outlines the RPII scope for inspections undertaken by the Inspectors listed as Annual Inspectors on the RPII Register of Inspectors when undertaking Indoor Annual, Outdoor Annual, Outdoor Operational and Outdoor Routine inspections.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it will be the standard that is current at the time of inspection except where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection, unless they are also explicitly listed here.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this includes public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below):

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document. It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 – Part 7) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standards (BS EN 71 series – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance will follow the requirements and recommendations of BS EN 1176.

When water play items, including spray parks, are inspected any comments concerning compliance within the inspection will refer to BS EN 1176. We have not assessed these against the requirements of BS EN 17232 (Water play equipment and features).

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment
BS EN 14974 Skateparks
BS EN 16630 Permanently installed outdoor fitness equipment
BS EN 16899 Parkour equipment (plus RPII/API guidance notes)

Annual and Post Installation inspections will take into consideration compliance with these current standards, and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area (that area which is obviously part of the playground), nominally up to three metres around, the fence line if closer, or other areas as agreed.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity, wear and vandalism.

Routine visual inspections relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

All inspections are non-dismantling, non-destructive and do not include any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all reasonably accessible equipment and will assess all reasonably accessible parts above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment.

Ancillary equipment will be assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to a general safety assessment).

The owner/operator is responsible for the overall safety of the equipment and area.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of the impact attenuating properties of any surfaces; the identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection; the inspection of any equipment (or part thereof) that is beneath the playing surface (loose-fill materials may be moved to expose foundations); tightening any bolts, hinges or other fixing devices on any apparatus or equipment; assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment; assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming); where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken – the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity. This inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/or that of the inspection company. The owner/operator should always seek the advice of the manufacturer or a competent person when undertaking repairs and/or modifications to equipment.

A full copy of the Play Inspection Company Ltd. Terms & Conditions is available on our website (www.playinspections.co.uk)

The operator is responsible for following the guidance of the relevant standards. The standards give guidance on the installation, inspection, maintenance and operation of the various types of facilities. The inspection guidance is listed in Table 1, with an indication of which parts will be included in an RPII Annual or Post-Installation Inspection. The relevant standards also contain additional parts which the operator should follow.

Inspection recommendations of relevant standards Refer to relevant standards for full text	Annual Main	RPII Annual/ Post Installation Inspection
6.1 d) Overall levels of safety of equipment (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of foundations (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of playing surfaces (see note 2)	✓	✓ [2]
6.1 d) Compliance with the relevant parts of the standard and or risk assessment (see note 3)	✓	✓ [3]
6.1 d) Effects of weather	✓	✓
6.1 d) Presence of rot, decay or corrosion (see note 1)	✓	✓ [1]
6.1 d) Assessment of repairs made or added or replaced components (see note 4)	✓	✓ [4]
6.1 d) Excavation or dismantling/additional measures	✓	✗
6.2.1 Assessment of glass reinforced plastics (see note 5)	✓	✓ [5]
6.2.1 Inspection of one post equipment (see note 1)	✓	✓ [1]
6.2.4 Undertaking the Operators inspection protocol	✓	✗

NB: The clause numbers in table 1 are taken from BS EN 1176 - Part 7:2020. The content is equally applicable to all other relevant standards listed herein. Playgrounds contain a range of equipment from different manufacturers and installed over a number of years; operators should implement any guidance provided by the manufacturer. Item specific detail is not readily available to RPII Playground Inspectors, whose report contributes to the operator's overall Annual Main Inspection as detailed in the relevant standards.

[1] A manual test only is undertaken for stability. Wear and instability are only detectable where readily apparent without dismantling or destruction and without the use of tools, excavation or specialist equipment. Rot and corrosion are tested or with a hammer and/or steel rod. Decay in timber may exist which can only be found with specialist equipment.

[2] Only the visible condition and dimensional compliance of surface extent is considered. Neither testing of impact attenuating properties nor measurement of the thickness of bound surfaces are undertaken on RPII annual inspections.

[3] The inspection assesses compliance where this can be tested on site using manual methods without dismantling, destruction and without the use of tools or specialist equipment.

[4] The operator should use manufacturer's recommended parts, or equivalent. We are unable to verify if such parts have been used, and any subsequent change in quality or performance.

[5] Visible glass fibres will be noted in reports. The operator is responsible for repairs or replacement.

Risk Assessment Matrix

			Scores in the report are multiplication factors of Likelihood x Severity					
			Severity>>					
Likelihood	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)
			Very Low	Low	Moderate	High	Very High	
			1	2	3	4	5	
			No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality	
			Severity>>					
<p>Note 1: The total risk scores included within our reports are a multiplication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).</p> <p>Note 2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.</p>								

Equipment has been assessed to the following standards where relevant:

- BS EN 1176 Parts 1-11 (Playground equipment and surfacing)
- BS EN 14974 (Facilities for users of roller sports equipment)
- BS EN 15312 (Free access multi-sports equipment)
- BS EN 16899 (Parkour Equipment)
- BS EN 16630 (Outdoor Fitness Equipment).



Buxhall

Inspection Ref: 2276287

Site Ref: 16598

Inspected: 25-January-2024 - 09:48 by Liam Last

Risk Assessment: 8 Low Risk



Location:

The site is located in an area of public open space and is not directly overlooked by any properties in the local community.

Disabled Access:

Some accessible features; an area that presents difficulties to the majority of people with disabilities but in favourable circumstances and certainly in partnership can be accessed.

i 4 - Very Low Risk

Item: Site General
Manufacturer: Owner/Operator
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -

i 4 - Very Low Risk

Item: Sign
Manufacturer: Owner/Operator
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



i 6 - Low Risk

Item: Bench
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 2

Finding 1

There is algae or moss on the surface of the equipment - Clean and treat appropriately

Finding 2

There is some evidence of rot in the timber - Monitor for any further deterioration and replace as required

i 6 - Low Risk

Item: Bench
Manufacturer: Not Identified
Surface Type: Tarmac
Item Quantity: 2
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

There are post / end caps missing from the item - Replace missing post caps

i 4 - Very Low Risk

Item: Picnic Table
Manufacturer: Not Identified
Surface Type: Tarmac
Item Quantity: 2
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Basketball Post
Manufacturer: Not Identified
Surface Type: Tarmac
Item Quantity: 2
Equipment Compliance: Yes
Surface Area Compliance: N/A



Total Findings: 3

Finding 1

There is moderate damage to the surface - Repair the damaged areas of surfacing

Finding 2

There are trip hazards at the edges of the surface - Remove the trip points

Finding 3

There is weed / vegetation growth on, between, or around the edges of the surfacing - Remove weed / vegetation growth

i 6 - Low Risk

Item: Football Goal
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 2
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 2



Finding 1

NB: We have undertaken a maintenance inspection only of the football goal(s); full load testing falls outside the scope of our inspection. - Implement load testing as required

Finding 2

The item is slightly loose in its foundations - Monitor for any further deterioration and repair as required

i 6 - Low Risk

Item: Goal End
Manufacturer: Not Identified
Surface Type: Grass
Item Part Number:
Item Quantity: 2
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 3



Finding 1

There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process - Monitor for any deterioration (rot) and replace as required

Finding 2

There is some evidence of rot in the timber - Monitor for any further deterioration and replace as required

Finding 3

The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process - Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability



i 8 - Low Risk

Item: Free Standing Slide
Manufacturer: Wicksteed Playgrounds
Surface Type: Rubber Tiles
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: No



Total Findings: 6

Finding 1

There is algae, silt or moss growth on the surface resulting in slippery conditions - Clean and treat appropriately

Finding 3

There are a number of dents in the slide surface - Monitor for any further deterioration and repair as required

Finding 5

The surfacing dimensions are short and do not meet with the requirements of the current applicable standard - Monitor - no remedial action recommended

Finding 2

There are gaps opening in between the tiles - Monitor for any further deterioration and repair as required

Finding 4

The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 head and neck entrapment in the barriers and/or steps - Monitor - No remedial work recommended

Finding 6

There are trip hazards at the edges of the surface - Reinstate surrounding surface levels to remove the trip points



i 6 - Low Risk

Item: Cable Runway
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 3



Finding 1

We have completed a visual inspection of the suspension links, cable and fixing points from ground level, however it is not possible to fully inspect these areas without either hiring equipment to gain access or removing the cable and suspension and inspecting at ground level. We recommend that the main cable and fixing security is thoroughly inspected at least in accordance with the manufacturers recommendations to check for wear, damage, security or internal rusting; this will help to ensure the continued safe use of the equipment - Inspect in accordance with the manufacturers recommendations

Finding 3

The ropes/nets are worn/damaged in places - Monitor for any further deterioration and repair or replace as required

Finding 2

The seat connection cannot be inspected without dismantling the seat - Dismantle the seat to inspect the seat connection for wear

i 8 - Low Risk

Item: 1 Bay 2 Seat (Cradle)
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 5

Finding 1

We do not recommend the installation of anti bird devices on equipment - Remove and replace with upturned cable ties

Finding 2

There is some notable evidence of chain wear - Monitor for any further deterioration and replace when 40% worn

Finding 3

There is algae or moss on the surface of the equipment - Clean and treat appropriately

Finding 4

There is some wear to the shackles - Monitor for any further deterioration and replace when 40% worn

Finding 5

The bushes are showing signs of wear - Monitor for any further deterioration and replace as required

i 6 - Low Risk

Item: Inclusive Roundabout
Manufacturer: Kompan Ltd
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

There are gaps opening between the surfacing and the edging surround or between the joints in the surfacing - Monitor for any further deterioration and repair as required

i 8 - Low Risk

Item: Spring Tractor
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 2

Finding 1

There is nettle growth by the equipment - Remove and maintain

Finding 2

A number of fixing(s) have worked loose - Secure all loose fixings

i 6 - Low Risk

Item: Spring Horse
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

There is some damage to the item - Monitor for any further deterioration and repair as required

i 8 - Low Risk

Item: 1 Bay 2 Seat (Flat)
Manufacturer: A.E.Evans
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 7

Finding 1

We do not recommend the installation of anti bird devices on equipment - Remove and replace with upturned cable ties

Finding 2

There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process - Monitor for any deterioration (rot) and replace as required

Finding 3

There is some evidence of rot in the timber - Monitor for any further deterioration and replace as required

Finding 4

The chain openings are in excess of 8.6mm and do not meet the recommendations of BS EN 1176 Part 1 - Monitor - No remedial work recommended

Finding 5

There is some notable evidence of chain wear - Monitor for any further deterioration and replace when 40% worn

Finding 6

There is some wear to the shackles - Monitor for any further deterioration and replace when 40% worn

Finding 7

The bushes are showing signs of wear - Monitor for any further deterioration and replace as required

i 4 - Very Low Risk

Item: Train
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 4 - Very Low Risk

Item: See Saw
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 4 - Very Low Risk

Item: Musical Instrument
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 4 - Very Low Risk

Item: Tractor
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Monkey Bars
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 6 - Low Risk

Item: Stilts
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

The step between the items is quite large and users may not be able to complete the step without touching ground, the items could therefore be considered to be within the falling space of each other, however the intention of the play activity continuity is easily apparent and foreseeable to the user - Monitor - No remedial work recommended

i 4 - Very Low Risk

Item: Stepping Posts Rubber
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 6 - Low Risk

Item: Balance Beam
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

The step between the items is quite large and users may not be able to complete the step without touching ground, the items could therefore be considered to be within the falling space of each other, however the intention of the play activity continuity is easily apparent and foreseeable to the user - Monitor - No remedial work recommended

i 6 - Low Risk

Item: Balance Beam
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

The step between the items is quite large and users may not be able to complete the step without touching ground, the items could therefore be considered to be within the falling space of each other, however the intention of the play activity continuity is easily apparent and foreseeable to the user - Monitor - No remedial work recommended



i 4 - Very Low Risk

Item: Multi Play (Junior)
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes

Total Findings: 1



Finding 1

This item is satisfactory - no work required -

Findings information

i 6 - Low Risk (Finding 1)

Item: Ancillary Items - Bench
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: There is algae or moss on the surface of the equipment

Action: Clean and treat appropriately

i 6 - Low Risk (Finding 2)

Item: Ancillary Items - Bench
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: There is some evidence of rot in the timber

Action: Monitor for any further deterioration and replace as required

i 6 - Low Risk (Finding 1)

Item: Ancillary Items - Bench
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Tarmac



Finding: There are post / end caps missing from the item

Action: Replace missing post caps

i 8 - Low Risk (Finding 1)

Item: Multi Use Games Area - Basketball Post
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Tarmac



Finding: There is moderate damage to the surface

Action: Repair the damaged areas of surfacing

i 8 - Low Risk (Finding 2)

Item: Multi Use Games Area - Basketball Post
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Tarmac



Finding: There are trip hazards at the edges of the surface **Action:** Remove the trip points

i 6 - Low Risk (Finding 3)

Item: Multi Use Games Area - Basketball Post
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Tarmac



Finding: There is weed / vegetation growth on, between, or around the edges of the surfacing **Action:** Remove weed / vegetation growth

i 0 - Risk Assessment not Undertaken (Finding 1)

Item: Multi Use Games Area - Football Goal
Manufacturer: Not Identified

Risk Level: N - Risk Assessment not Undertaken
Surface: Grass



Finding: NB: We have undertaken a maintenance inspection only of the football goal(s); full load testing falls outside the scope of our inspection.

Action: Implement load testing as required

i 6 - Low Risk (Finding 2)

Item: Multi Use Games Area - Football Goal
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: The item is slightly loose in its foundations

Action: Monitor for any further deterioration and repair as required

i 6 - Low Risk (Finding 1)

Item: Multi Use Games Area - Goal End
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process

Action: Monitor for any deterioration (rot) and replace as required

i 6 - Low Risk (Finding 2)

Item: Multi Use Games Area - Goal End
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: There is some evidence of rot in the timber

Action: Monitor for any further deterioration and replace as required

i 6 - Low Risk (Finding 3)

Item: Multi Use Games Area - Goal End
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process
Action: Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

i 8 - Low Risk (Finding 1)

Item: Other - Free Standing Slide
Manufacturer: Wicksteed Playgrounds

Risk Level: L - Low Risk
Surface: Rubber Tiles



Finding: There is algae, silt or moss growth on the surface resulting in slippery conditions
Action: Clean and treat appropriately

i 6 - Low Risk (Finding 2)

Item: Other - Free Standing Slide
Manufacturer: Wicksteed Playgrounds

Risk Level: L - Low Risk
Surface: Rubber Tiles



Finding: There are gaps opening in between the tiles

Action: Monitor for any further deterioration and repair as required

i 4 - Very Low Risk (Finding 3)

Item: Other - Free Standing Slide
Manufacturer: Wicksteed Playgrounds

Risk Level: V - Very Low Risk
Surface: Rubber Tiles



Finding: There are a number of dents in the slide surface

Action: Monitor for any further deterioration and repair as required

i 5 - Very Low Risk (Finding 4)

Item: Other - Free Standing Slide
Manufacturer: Wicksteed Playgrounds

Risk Level: V - Very Low Risk
Surface: Rubber Tiles



Finding: The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 head and neck entrapment in the barriers and/or steps

Action: Monitor - No remedial work recommended

i 5 - Very Low Risk (Finding 5)

Item: Other - Free Standing Slide
Manufacturer: Wicksteed Playgrounds

Risk Level: V - Very Low Risk
Surface: Rubber Tiles



Finding: The surfacing dimensions are short and do not meet with the requirements of the current applicable standard

Action: Monitor - no remedial action recommended

i 8 - Low Risk (Finding 6)

Item: Other - Free Standing Slide
Manufacturer: Wicksteed Playgrounds

Risk Level: L - Low Risk
Surface: Rubber Tiles



Finding: There are trip hazards at the edges of the surface

Action: Reinstate surrounding surface levels to remove the trip points

i 0 - Risk Assessment not Undertaken (Finding 1)

Item: Other - Cable Runway
Manufacturer: Kompan Ltd

Risk Level: N - Risk Assessment not Undertaken
Surface: Grass Matrix Tiles



Finding: We have completed a visual inspection of the suspension links, cable and fixing points from ground level, however it is not possible to fully inspect these areas without either hiring equipment to gain access or removing the cable and suspension and inspecting at ground level. We recommend that the main cable and fixing security is thoroughly inspected at least in accordance with the manufacturers recommendations to check for wear, damage, security or internal rusting; this will help to ensure the continued safe use of the equipment

Action: Inspect in accordance with the manufacturers recommendations

i 0 - Risk Assessment not Undertaken (Finding 2)

Item: Other - Cable Runway
Manufacturer: Kompan Ltd

Risk Level: N - Risk Assessment not Undertaken
Surface: Grass Matrix Tiles



Finding: The seat connection cannot be inspected without dismantling the seat

Action: Dismantle the seat to inspect the seat connection for wear

i 6 - Low Risk (Finding 3)

Item: Other - Cable Runway
Manufacturer: Kompan Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The ropes/nets are worn/damaged in places

Action: Monitor for any further deterioration and repair or replace as required

i 8 - Low Risk (Finding 1)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass




Finding: We do not recommend the installation of anti bird devices on equipment

Action: Remove and replace with upturned cable ties

i 6 - Low Risk (Finding 2)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass

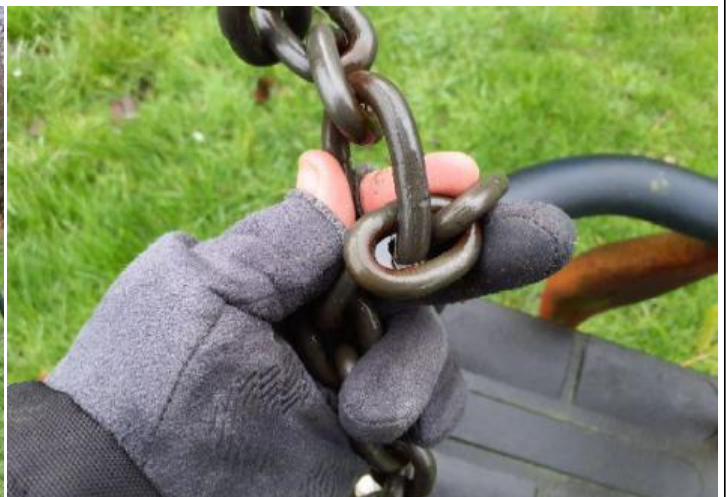

Finding: There is some notable evidence of chain wear

Action: Monitor for any further deterioration and replace when 40% worn

i 8 - Low Risk (Finding 3)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: There is algae or moss on the surface of the equipment

Action: Clean and treat appropriately

i 6 - Low Risk (Finding 4)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: There is some wear to the shackles

Action: Monitor for any further deterioration and replace when 40% worn

i 4 - Very Low Risk (Finding 5)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Grass



Finding: The bushes are showing signs of wear

Action: Monitor for any further deterioration and replace as required

i 6 - Low Risk (Finding 1)

Item: Rotor Play - Inclusive Roundabout
Manufacturer: Kompan Ltd

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There are gaps opening between the surfacing and the edging surround or between the joints in the surfacing

Action: Monitor for any further deterioration and repair as required

i 8 - Low Risk (Finding 1)

Item: Rocking Equipment - Spring Tractor
Manufacturer: Kompan Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is nettle growth by the equipment

Action: Remove and maintain

i 6 - Low Risk (Finding 2)

Item: Rocking Equipment - Spring Tractor
Manufacturer: Kompan Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: A number of fixing(s) have worked loose

Action: Secure all loose fixings

i 6 - Low Risk (Finding 1)

Item: Rocking Equipment - Spring Horse
Manufacturer: Kompan Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some damage to the item

Action: Monitor for any further deterioration and repair as required

i 8 - Low Risk (Finding 1)

Item: Swings - 1 Bay 2 Seat (Flat)
Manufacturer: A.E.Evans

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: We do not recommend the installation of anti bird devices on equipment

Action: Remove and replace with upturned cable ties

i 6 - Low Risk (Finding 2)

Item: Swings - 1 Bay 2 Seat (Flat)
Manufacturer: A.E.Evans

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process

Action: Monitor for any deterioration (rot) and replace as required

i 6 - Low Risk (Finding 3)

Item: Swings - 1 Bay 2 Seat (Flat)
Manufacturer: A.E.Evans

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some evidence of rot in the timber

Action: Monitor for any further deterioration and replace as required

i 5 - Very Low Risk (Finding 4)

Item: Swings - 1 Bay 2 Seat (Flat)
Manufacturer: A.E.Evans

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: The chain openings are in excess of 8.6mm and do not meet the recommendations of BS EN 1176 Part 1

Action: Monitor - No remedial work recommended

i 6 - Low Risk (Finding 5)

Item: Swings - 1 Bay 2 Seat (Flat)
Manufacturer: A.E.Evans

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some notable evidence of chain wear

Action: Monitor for any further deterioration and replace when 40% worn

6 - Low Risk (Finding 6)

Item:	Swings - 1 Bay 2 Seat (Flat)	Risk Level:	L - Low Risk
Manufacturer:	A.E.Evans	Surface:	Grass Matrix Tiles



Finding:	There is some wear to the shackles	Action:	Monitor for any further deterioration and replace when 40% worn
-----------------	------------------------------------	----------------	---

4 - Very Low Risk (Finding 7)

Item:	Swings - 1 Bay 2 Seat (Flat)	Risk Level:	V - Very Low Risk
Manufacturer:	A.E.Evans	Surface:	Grass Matrix Tiles



Finding:	The bushes are showing signs of wear	Action:	Monitor for any further deterioration and replace as required
-----------------	--------------------------------------	----------------	---

i 6 - Low Risk (Finding 1)

Item: Activity Equipment - Stilts
Manufacturer: Kompan Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The step between the items is quite large and users may not be able to complete the step without touching ground, the items could therefore be considered to be within the falling space of each other, however the intention of the play activity continuity is easily apparent and foreseeable to the user

Action: Monitor - No remedial work recommended

i 6 - Low Risk (Finding 1)

Item: Activity Equipment - Balance Beam
Manufacturer: Kompan Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The step between the items is quite large and users may not be able to complete the step without touching ground, the items could therefore be considered to be within the falling space of each other, however the intention of the play activity continuity is easily apparent and foreseeable to the user

Action: Monitor - No remedial work recommended

i 6 - Low Risk (Finding 1)

Item: Activity Equipment - Balance Beam
Manufacturer: Kompan Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The step between the items is quite large and users may not be able to complete the step without touching ground, the items could therefore be considered to be within the falling space of each other, however the intention of the play activity continuity is easily apparent and foreseeable to the user

Action: Monitor - No remedial work recommended